

Product Recall Notification

First Alert FE-F600-FA-BNL – Brandblusser/Extincteur
Sold between September 2017 – February 2018

Defect

Faulty actuator (nozzle) which may be blocked due to an injection moulding error, potentially causing a malfunction within the firing mechanism which could result in some units not discharging the extinguishant. The faulty actuator (nozzle) is the **yellow** plastic part shown here

Product Identification



SUSPECT PRODUCTS CAN BE IDENTIFIED AS FOLLOWS.

EACH EXTINGUISHER IS MARKED IN TWO PLACES TO IDENTIFY WHEN IT WAS MANUFACTURED. ON THE REAR OF THE EXTINGUISHER AT THE BOTTOM THERE IS A MANUFACTURE YEAR, EXAMPLE BELOW IS 2018. THERE IS ALSO A SERIES OF DOTS INDICATING THE MONTH OF MANUFACTURE .



Example above with 10 dots and 2018 = manufactured in February 2018

Products affected have yellow actuator (nozzle) and are marked with 2017 and 0, 1, 2, or 3 white dots 2018 and 11 or 10 white dots

NON-YELLOW ACTUATORS (NOZZLES) AND ALL OTHER COMBINATIONS OF YEAR AND WHITE DOTS ARE GOOD AND NOT SUBJECT TO THIS RECALL

Fault

Blocked actuator within the plastic firing mechanism meaning the extinguisher will not discharge its contents in a percentage of products

Risk

There is no direct risk from the product itself. Extinguishers identified as 'SUSPECT' may not discharge contents when used

Action required

Please return your product to store immediately for replacement. For any queries please contact the support line on 0044 208 310 3950 or email sales@fxfire.co.uk