

Product Recall Notification

FX FIRE FX600MF – Foam Extinguisher
 Manufactured and Sold between February 2018

Defect


Faulty actuator (nozzle) which may be blocked due to an injection moulding error, potentially causing a malfunction within the firing mechanism which could result in some units not discharging the extinguishant. The faulty actuator (nozzle) is the **yellow** plastic part shown here

Product Identification



EACH EXTINGUISHER HAS A YELLOW NOZZLE AND IS MARKED WITH A DATE CODE TO IDENTIFY WHEN IT WAS MANUFACTURED. ON THE REAR OF THE EXTINGUISHER THERE IS A MANUFACTURE YEAR AND ALSO A SERIES OF WHITE DOTS WITH LETTERS INDICATING THE MONTH OF MANUFACTURE

ONE PRODUCTION BATCH OF THE EXTINGUISHER IS AFFECTED, THE MANUFACTURE YEAR IS LISTED AS 2018 AND THERE ARE 11 WHITE DOTS AND LETTERS ABOVE INDICATING MONTH OF PRODUCTION

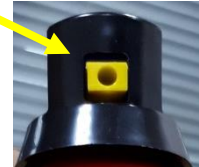

Fault

Blocked actuator within the plastic firing mechanism meaning the extinguisher will not discharge its contents in a high percentage of products

Risk

There is no direct risk from the product itself. Extinguishers identified as 'SUSPECT' may not discharge contents when used

Action required

Please return your product to store immediately for replacement. For any queries please contact the support line on 0044 208 310 3950 or email sales@fxfire.co.uk